

LUSCOMBE AIRPLANE CORPORATION
DALLAS, TEXAS

December 3, 1946

SERVICE BULLETIN 5-46

SUBJECT: Installation Battery Cable Clip
Fwd Sta. 2 R.H. Side (R.H. Side Door)

MODEL: 8E Opt. only.

SERIAL NUMBER: 3072 thru 4455

To preclude possible short circuiting of the Battery Cable, the following action is to be incorporated in the subject aircraft at the earliest possible moment.

1. Remove R.H. Kick Panel
2. Drill out Rivet as shown on sketch
3. Install Angle Clip with Rivet
4. Install Clamp to Clip with Nuts and Screws
5. Clean out Area
6. Install R.H. Kick Panel

The following parts are required for this installation:

Part	No. Required
186123 Clip	1
AN 740-10C Clamp	1
AN3-3 Bolt	1
AN960-10L Washer	1
AN365-1032 Nut	1


/s/ E.W. Norris
Chief Engineer

/s/ Otto W. Hoernig
Service Manager

Retyped March 2, 1960
SILVAIRE AIRCRAFT CO.
P.O. BOX 719
FORT COLLINS, COLORADO

ped

- (A) AN3-3 Bolt
AN960-10L Washer
AN365-1032 Nut
- (B) AN456AD4-4 Rivet
- (C) 186123 Clip
- (D) Battery Cable
- (E) AN740-10C Clamp

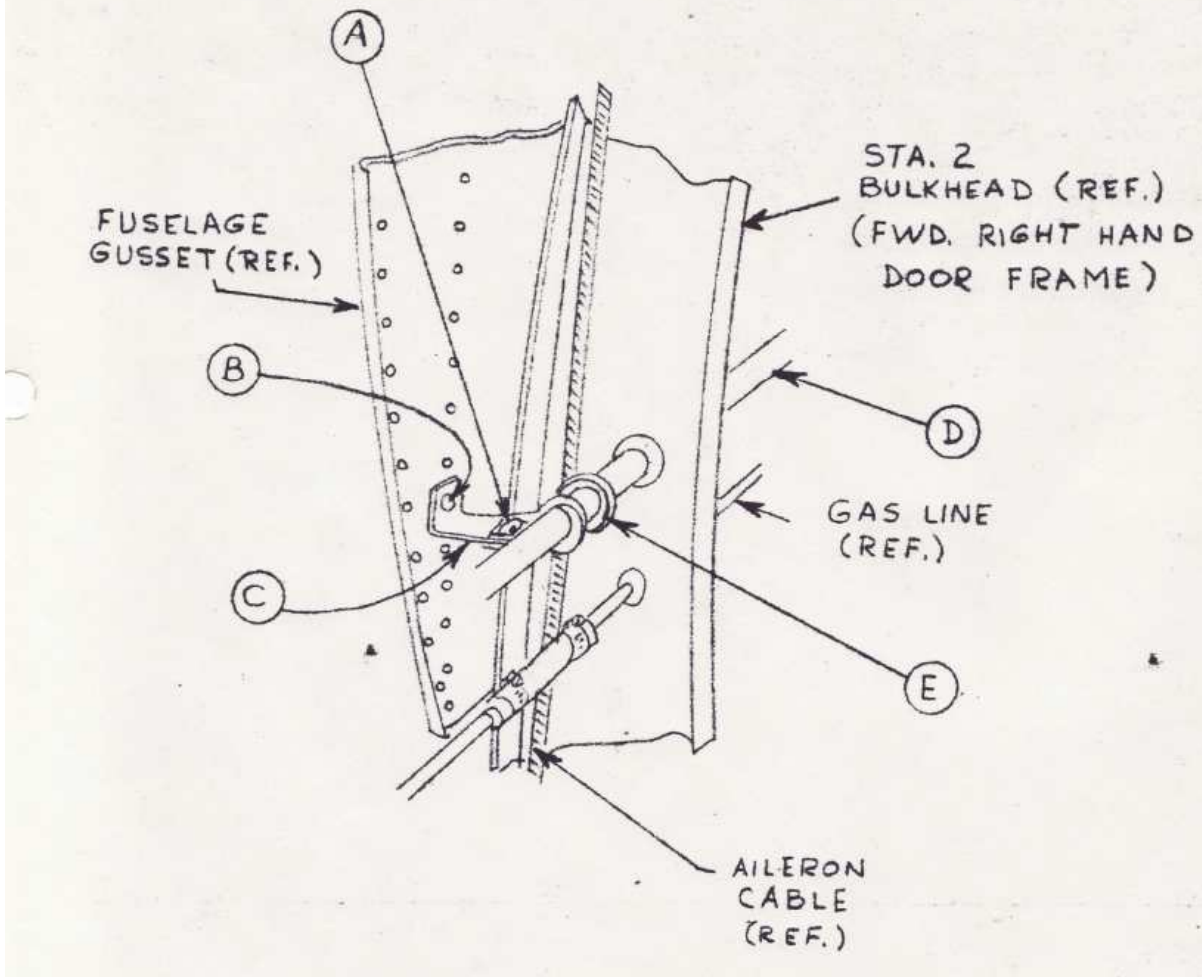

Remove Rivet; as shown (B) (sixth Rivet from Bottom of Fuselage Gusset).
Install AN & Luscombe Parts as shown.